

This Page Is Inserted by IFW Operations
and is not a part of the Official Record

BEST AVAILABLE IMAGES

Defective images within this document are accurate representations of the original documents submitted by the applicant.

Defects in the images may include (but are not limited to):

- BLACK BORDERS
- TEXT CUT OFF AT TOP, BOTTOM OR SIDES
- FADED TEXT
- ILLEGIBLE TEXT
- SKEWED/SLANTED IMAGES
- COLORED PHOTOS
- BLACK OR VERY BLACK AND WHITE DARK PHOTOS
- GRAY SCALE DOCUMENTS

IMAGES ARE BEST AVAILABLE COPY.

**As rescanning documents *will not* correct images,
please do not report the images to the
Image Problem Mailbox.**

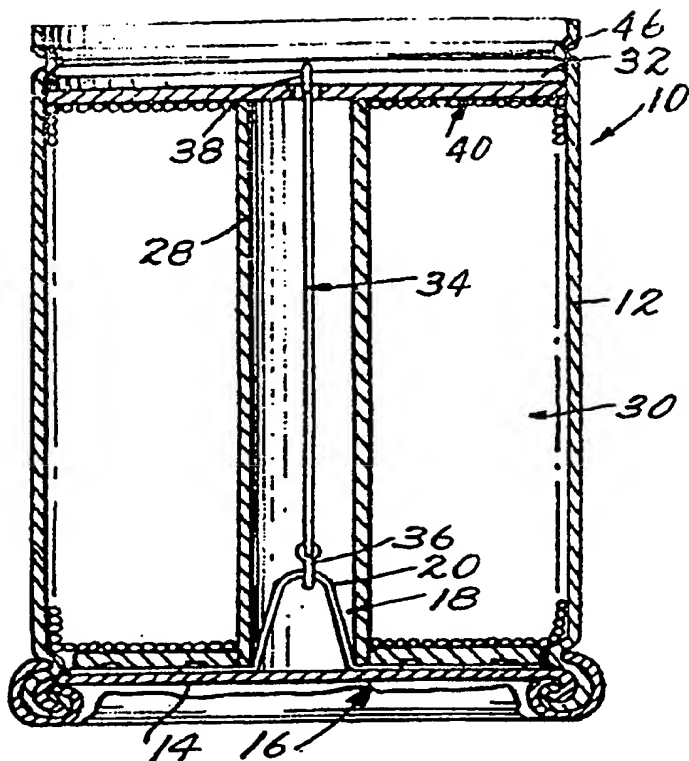


Fig. 1.
PRIOR ART

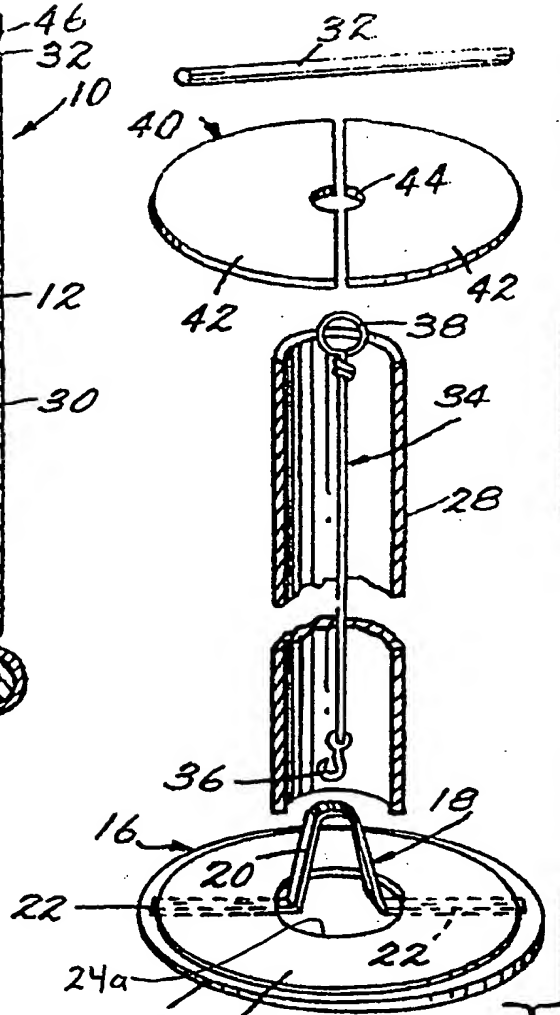


Fig. 2.
PRIOR ART

09937282 12304

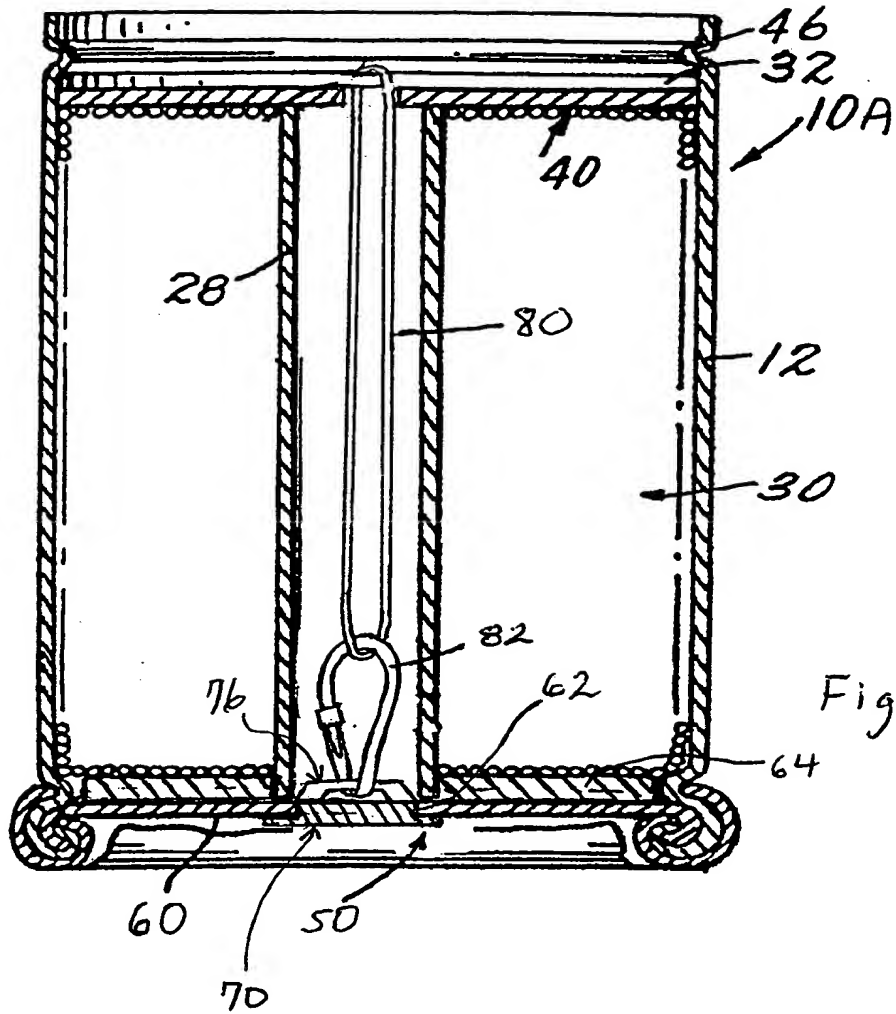


Fig. 3

0937282-1

FIG. 4

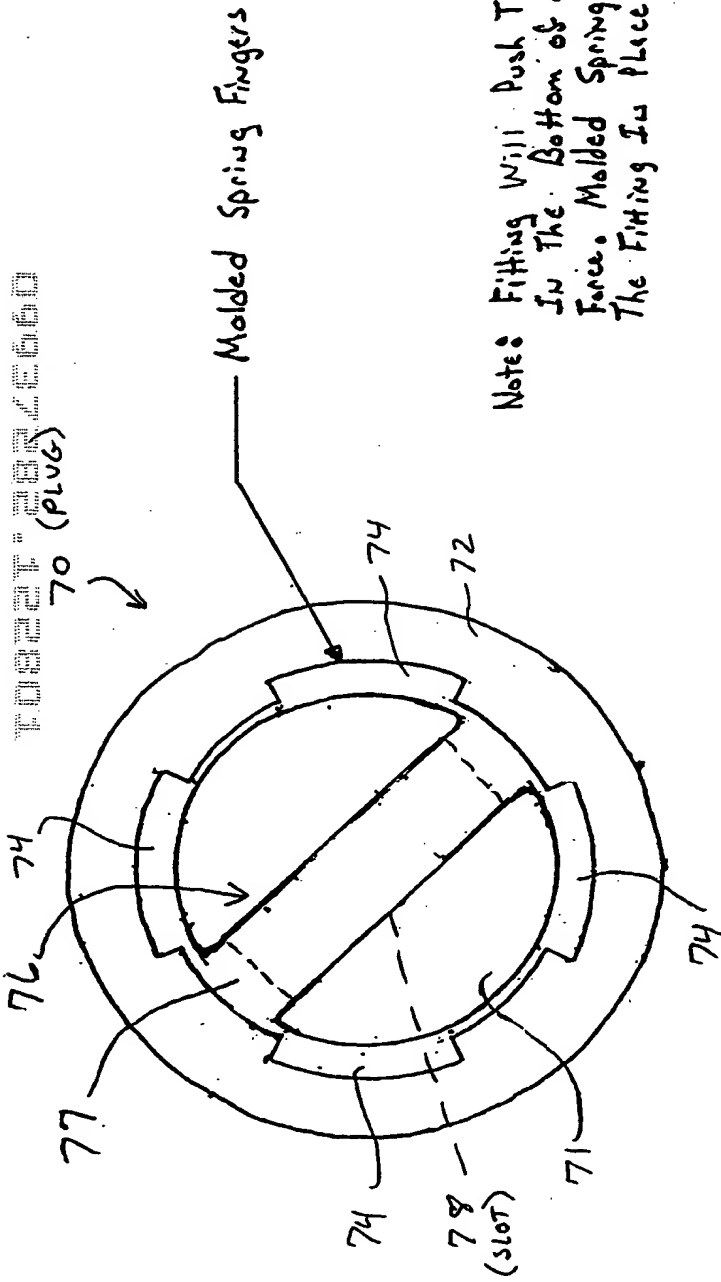


Fig. 4

Note: Fitting Will Push Through a 2" Hole In The Bottom of a Drum, With Head Force. Molded Spring Fingers Will Keep The Fitting In Place.

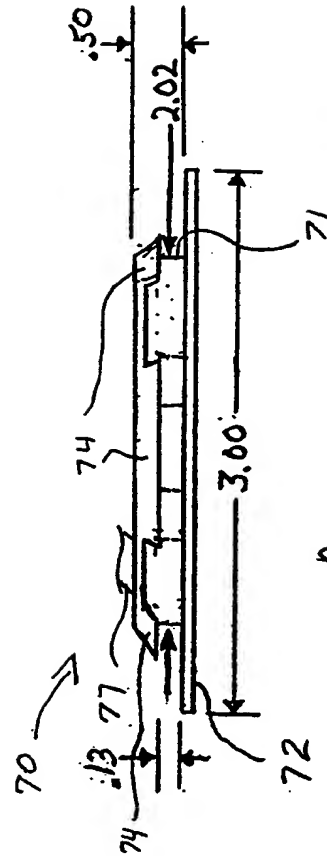


Fig. 5


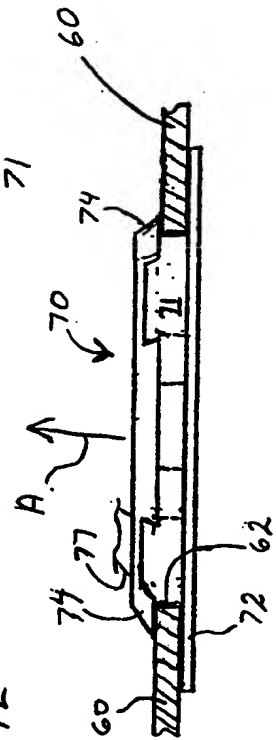


Fig. 6


76 78 82 77

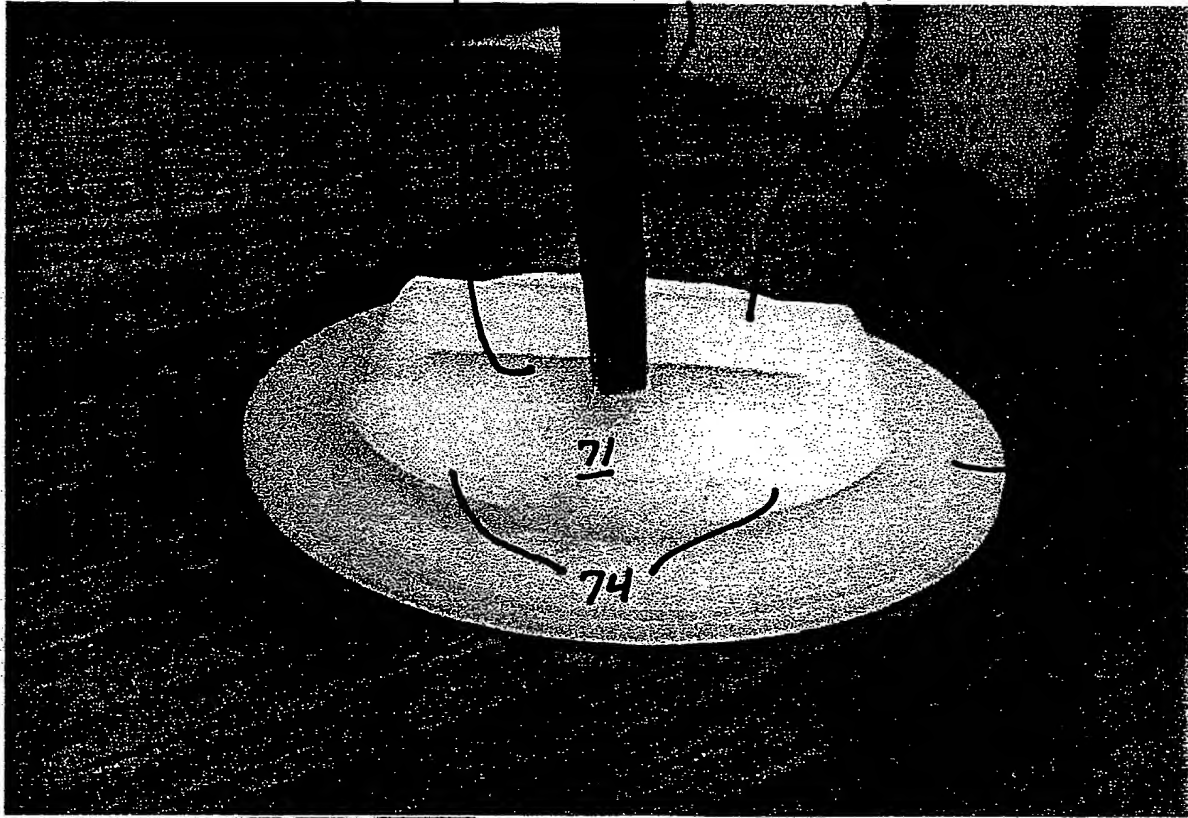

70

72

Fig. 8

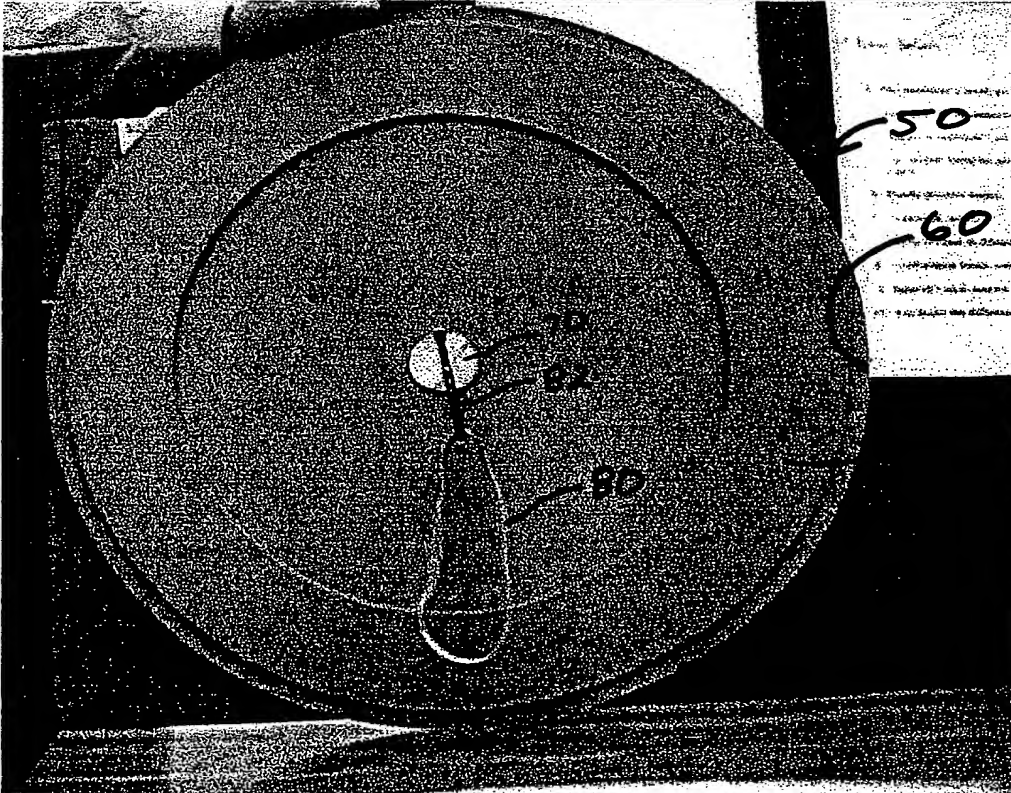

50

60

70

82

80

Fig. 7

64

0997282-12801

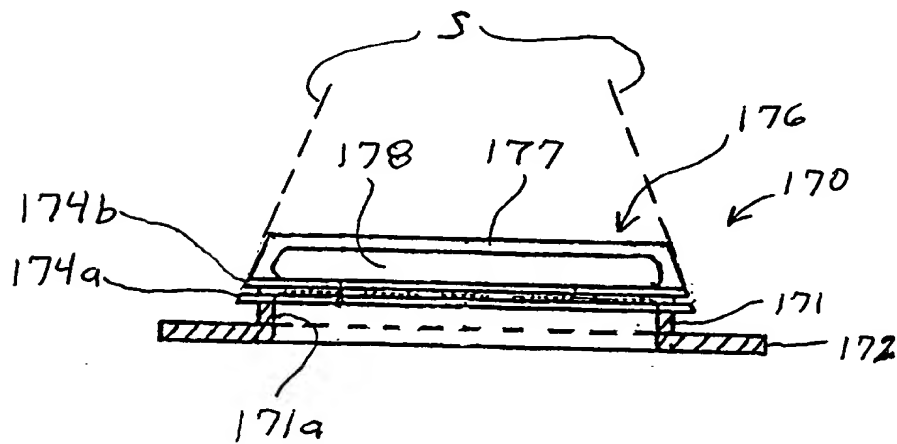
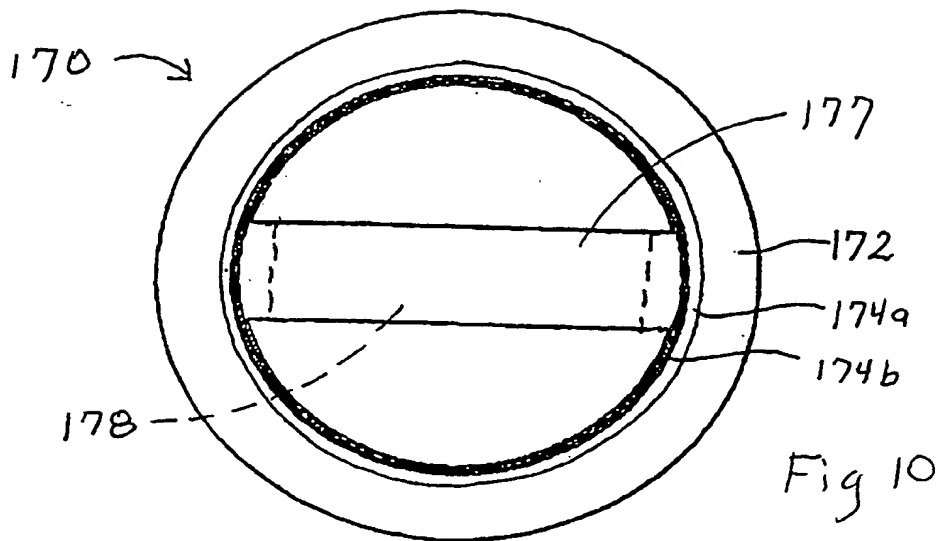


FIG. 9